

# Restoring windows

1. Label frames, glass and fittings when dismantling
2. Dismantle glass and frames. (putty lamp)
3. Clean window fittings by boiling in linseed soap and water
4. Clean the edges of glass and check the condition of the glass
5. Remove paint (spot heater)
6. Repair damaged wood and sand
7. Exterior: On dry wood impregnate with raw, hot linseed oil or heat with hot air
8. Fill small cracks and corner joints with putty/thinned putty
9. Attach window fittings in linseed putty
10. Barrier layer on knots and rebates (shellac)
11. Glaze with Linseed Putty. Bedding putty and glazing putty
12. Pin glass with a glass hammer and flat pins
13. Insert wooden blocks with wooden pins
14. Paint **UNDERCOAT** with Allbäck solvent-free Linseed Oil Paint
15. Inside: Prime with Allbäck Primer/chalk. Sand
16. **FINISH PAINTING** with **AT LEAST TWO** coats out onto the glass
17. Cut the edges of the putty and polish the glass
18. Hang the frames inside the casing on greased hinges

---

## Stove Blacking with rust protection

Stove Blacking consists of raw linseed oil and graphite powder.

- Brush off loose rust.
- Apply with a brush, cloth or sponge.
- Wipe with a soft cloth.
- And you're ready to carefully light your first fire!

